

## SERVICE BULLETIN NO. 246 - PIPER

PIPER AIRCRAFT CORPORATION  
LOCK HAVEN, PA  
U.S.A.

### PIPER CONSIDERS COMPLIANCE MANDATORY.

"FAA DOA EA-1 Approved"

#### DATE:

March 21, 1967

#### SUBJECT:

Modification of Oxygen Cylinder Rear Retaining Strap Piper Part Number 758 109

#### MODELS AFFECTED:

PA-30 Twin Comanches ( **NOTE:** Applicable only to aircraft that have had an oxygen system installed at the factory or aircraft that have had Piper Oxygen Installation Kit 757 100 installed.)

#### SERIAL NUMBERS AFFECTED:

30-853, 30-902 to 30-1470 incl. (See note above)

#### COMPLIANCE DATE:

Prior to but not later than next 25 hours of operation

#### REASON FOR BULLETIN:

Modification of the oxygen cylinder rear retaining strap part number 758 109 to preclude the possibility of the strap rubbing the rudder control cable.

#### MATERIAL REQUIRED:

None

#### MODIFICATION INSTRUCTIONS:

See sketch BELOW.

#### WARRANTY LABOR ALLOWED:

None


#### NOTE

All Oxygen Cylinder Rear Retaining Straps, part number 758 109, contained in Oxygen Cylinder Mounting Modification Kits, part number 757 094, (Reference Service Bulletin No. 236) in distributor or dealer stock must also be modified per this bulletin.

#### SKETCH

NOTE

(ILLEGIBLE) RETAINING STRAP HERE (TOP  
(ILLEGIBLE). REMOVE REAR PORTION  
STRAP AND RUBBER STRIP, 13945-85

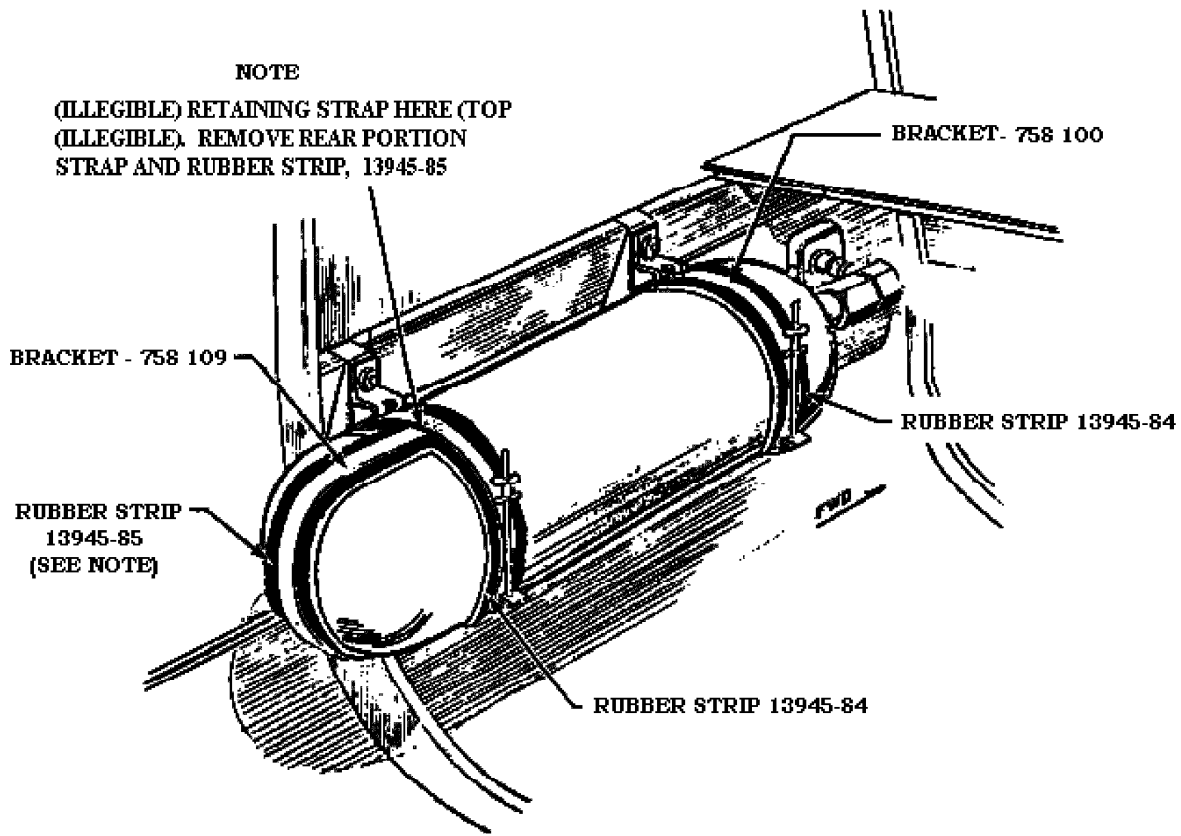

***SERVICE BULLETIN***  
***246***