

412A - PIPER

Customer Services SERVICE LETTER

Piper Aircraft Corporation
Lock Haven, Pennsylvania, U.S.A.

Date:
May 6, 1964
(Supersedes Service Letter No. 412)

TO:
Distributors, Dealers, Certified Service Centers and Owners

SUBJECT:
Muffler and Tailpipe Support

MODELS AFFECTED:
PA-24"250" Comanches only, Serial Nos. 24-2175, 24-2299 to 24-3321 incl., 24-3323 to 24-3394 incl., 24-3396 to 24-3437 incl., 24-3439 to 24-3441 incl., 24-3443, 24-3444, 24-3446 to 24-3457 incl., 24-3459, 24-3460, 24-3462 to 24-3464 incl., 24-3466 to 24-3484 incl., 24-3488 to 24-3536 incl., 24-3538 to 24-3549 incl., 24-3551 to 24-3557 incl.

This Service Letter is to advise that a muffler support bracket and a bracket to support the tailpipe are available for installation on the subject aircraft.

These supports are applicable to the PA-24 "250" Comanches within the serial numbers listed above and it is recommended that they be installed on these aircraft as the additional support will be instrumental in extending the service life of the exhaust system.


Kit No. 756 775 may be ordered through your Piper distributor or dealer at a suggested retail price of \$28.08.

Very truly yours,

PIPER AIRCRAFT CORPORATION


Wes Holmes
Service Manager

WH:dtt

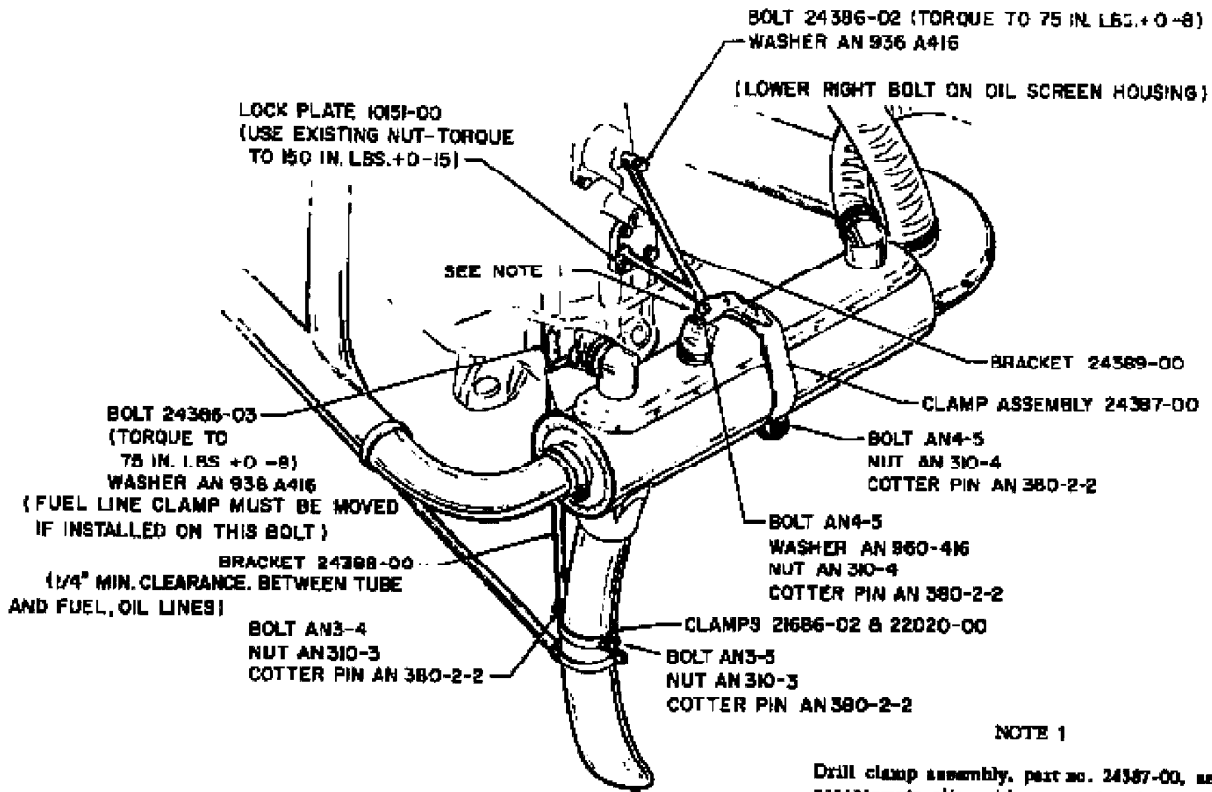

NOTE 1

Drill clamp assembly, part no. 24387-00, as necessary to align with support bracket, part no. 24389-00. Disregard the two tooling holes in the clamp assembly. (Use .250 drill)

SERVICE LETTER No. 412A

NOTE 1
 Drill clamp assembly, part no. 24387-00, as necessary to align with support bracket, part no. 34389-00. Disregard the two tooling holes in the clamp assembly. (Use .250 drill)

SERVICE LETTER No. 412A