



**SERVICE** *No. 366*  
**LETTER**

Piper Aircraft Corporation

Lock Haven, Pennsylvania, U.S.A.

January 3, 1962

---

TO: Distributors, Dealers, Certified Service Centers and Owners  
SUBJECT: Nose Gear Clevis  
MODELS AFFECTED: PA-24 and PA-24 "250" Comanches - Serial Nos. 24-1 to 24-2609 inclusive

A new high strength nose gear clevis, part number 20859-03, is available to replace the nose gear clevis with which the early models of Comanche aircraft were equipped.

This new clevis may be identified by the letters "H.T." etched on the side of the fitting. We are of the opinion that since this new high strength fitting will provide longer service life, the owners and operators of the affected aircraft should replace the present clevis with this improved one. See sketch below


NOTE:

This clevis, when installed, must be tight in the forgoing (13 to 40 ft. lbs. torque) and nut must be inboard.

**Very truly yours,**

**PIPER AIRCRAFT CORPORATION**

  
Wes Holmes  
**Service Manager**

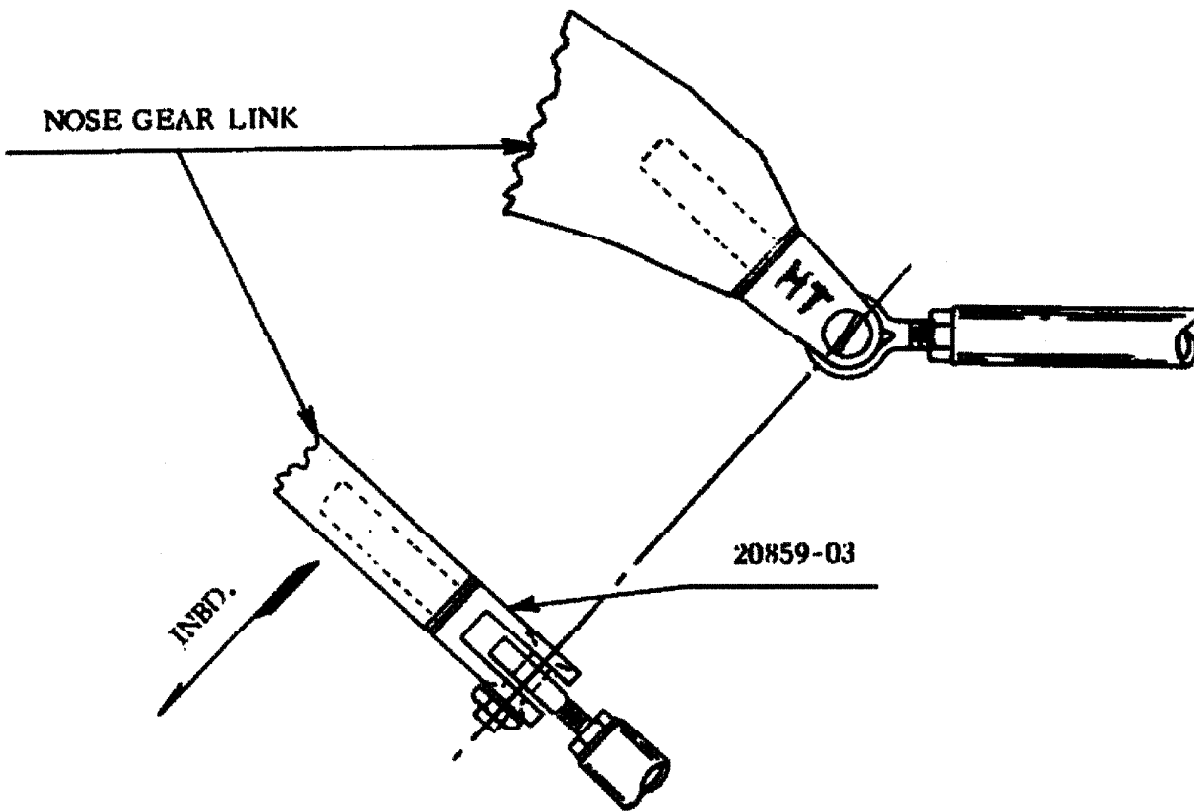

SERVICE LETTER NO. 366